 

 



















 


R300 Series (K34* & K35* Firmware) ZERO/SPAN Calibration Procedure

Start with indicator powered on and in normal weighing mode

1		Press (Power & "f" key) together for 2 seconds to access full setup mode	
2	 2x	Press ZERO key (2X)	
3	 1x	Press TARE key (1X)	
4	Remove all weight from the scale platform		
5	 1x	Press GROSS/NET Key (1X)	
6	 1x	PRINT key (1X)	 
7	 1x	TARE key (1X)	
8	 1x	TARE key again (1X)	
9	 1x	GROSS/NET key (1X).	
10	Add calibration weight to scale platform		
11	 1x	GROSS/NET key (1X) <ul style="list-style-type: none"> • GROSS/NET will select the digit • PRINT will edit the digit (scroll up) 	
12	 1x	PRINT key (1X)	 
13		Press (Power & "f" key) together for 2 seconds to save and exit.	